

PLACA DE GUIA

ESCOLHA DA LIGA:

JDY = BRONZE SAE 430B

JDH = AÇO - SEM LUBRIFICANTE SÓLIDO 8620

LIGAS / FORMAS:

JDY



Forma A



Forma B



Forma C



Forma D

JDH



Forma A



Forma B



Forma C



Forma D


EXEMPLO DE ESCOLHA / DETALHES DA PLACA GUIA:

Tolerâncias: 20= -0,02 | L= -0,2 | C= -0,2 |
L1= ±0,2 | C1= ±0,2 | F=±0,2


Liga = JDY ou JDH
L=50mm = 50
C=80mm = 80

Exemplo de código = JDY5080

JDY

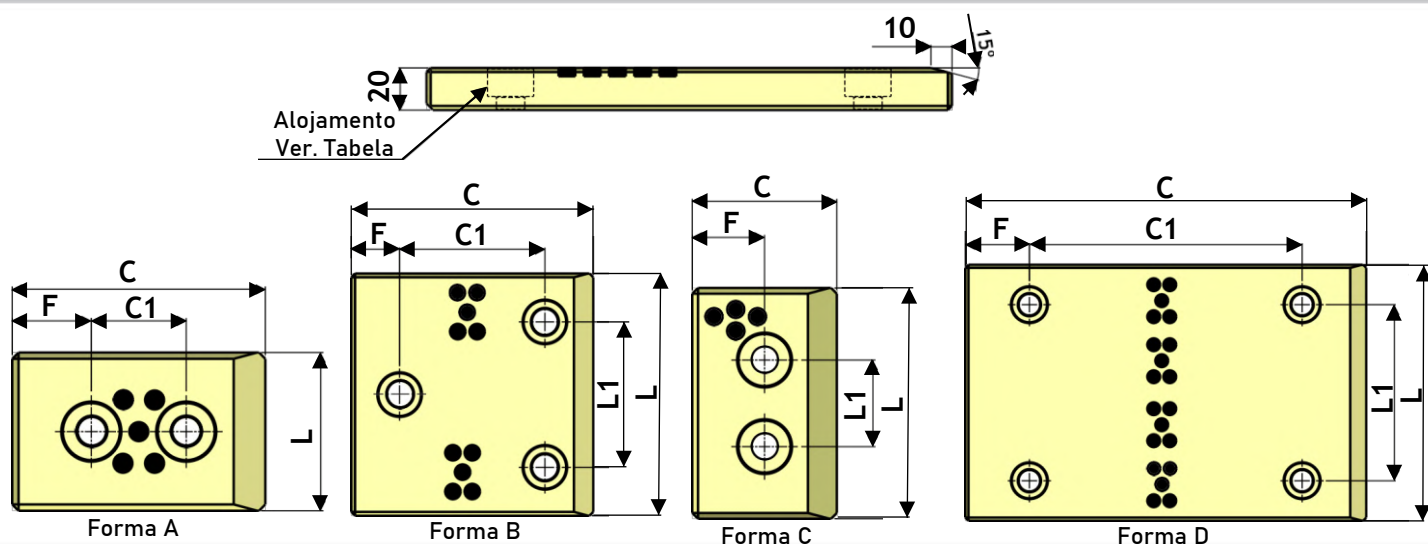

JDH

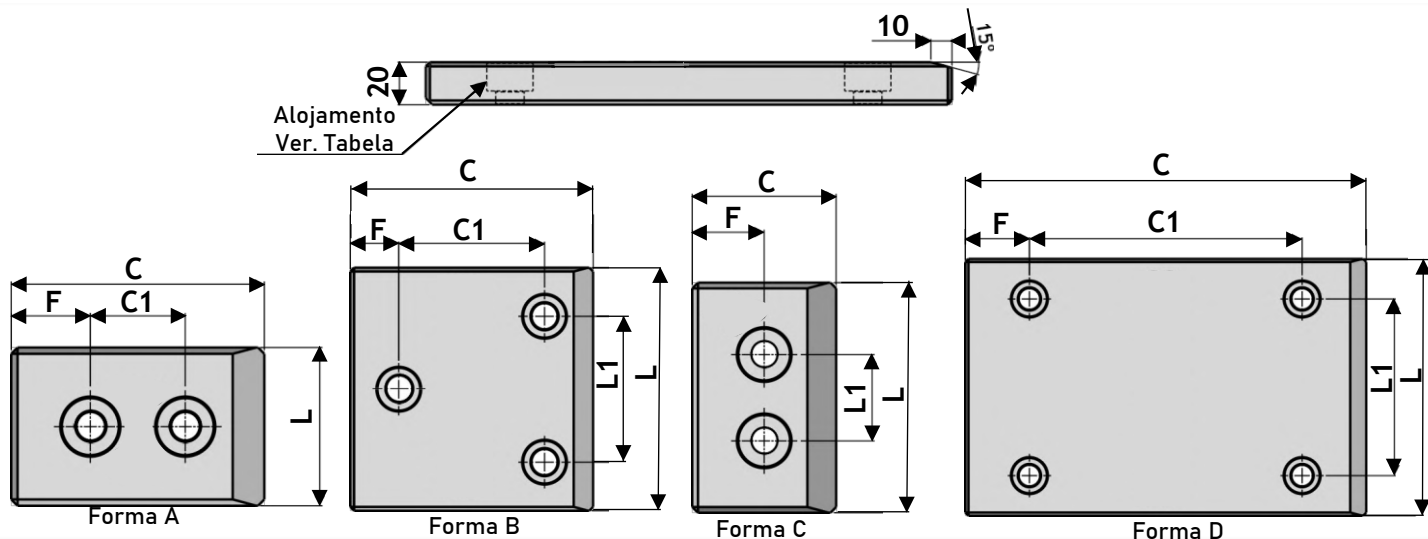

PLACA DE GUIA

Tabela Dimensional

JDY

BRONZE
SAE 430B

JDH

AÇO - SEM LUBRIFICANTE
SÓLIDO 8620

JDY JDH	L	C	L1	C1	F	Parafuso	Forma
5080	50	80	-	30	25	M8	A
50100	50	100	-	50	25	M12	A
50125	50	125	-	75	25	M12	A
50160	50	160	-	110	25	M12	A
50200	50	200	-	150	25	M12	A
8050	80	50	30	-	25	M 8	C
8080	80	80	-	30	25	M 12	A
80100	80	100	-	50	25	M 12	A
80125	80	125	-	75	25	M 12	A
80160	80	160	-	110	25	M 12	A
80200	80	200	-	150	25	M 12	A
80250	80	250	-	100	25	M 12	A
80315	80	315	-	132.5	25	M 12	A
10050	100	50	50	-	25	M12	C
10080	100	80	50	-	40	M12	C
100100	100	100	-	50	25	M 12	A
100125	100	125	-	75	25	M 12	A
100160	100	160	-	110	25	M 12	A
100200	100	200	-	150	25	M 12	A
100250	100	250	-	100	25	M 12	A

JDY JDH	L	C	L1	C1	F	Parafuso	Forma
100315	100	315	-	132.5	25	M12	A
12550	125	50	75	-	25	M 12	C
12580	125	80	75	-	40	M 12	C
125100	125	100	75	50	25	M 12	B
125125	125	125	75	75	25	M 12	B
125160	125	160	75	110	25	M 12	B
125200	125	200	75	150	25	M 12	B
125250	125	250	75	170	40	M 12	D
125315	125	315	75	235	40	M 12	D
16050	160	50	110	-	25	M 12	C
16080	160	80	110	-	40	M 12	C
160100	160	100	110	50	25	M 12	B
160125	160	125	110	75	25	M 12	B
160160	160	160	110	110	25	M 12	B
160200	160	200	110	150	25	M 12	B
160250	160	250	110	170	40	M 12	D
160315	160	315	110	235	40	M 12	D
200200	200	200	150	150	25	M 12	D